



Industrial process interface (PIF)

innovative infrared technology



optris® Industrial process interface

TECHNICAL DATA

Features:


- Industrial process interface with 3 analog / alarm outputs, 2 analog inputs, 1 digital input, 3 alarm relays
- 500 VAC_{RMS} isolation voltage between camera and process
- Separate fail-safe relay output
- PI/Xi hardware including all cable connections and PIX Connect software are permanently observed during operation



General specifications

Environmental rating	IP65 (NEMA-4)
Ambient temperature	-30 °C ... 85 °C (-22 °F ... 185 °F)
Storage temperature	-30 °C ... 85 °C (-22 °F ... 185 °F)
Relative humidity	10–95 %, non condensing
Vibration	IEC 60068-2-6 (sinusoidal form) IEC 60068-2-64 (broadband noise)
Shock	IEC 60068-2-27 (25 G and 50 G)
Weight	610 g (21.5 oz) (with 5 m [16.4 ft] cable)
Cable length	5 m (16.4 ft) HT cable (standard), optional 10 m and 20 m (32.8 ft and 65.5 ft)

Technical images

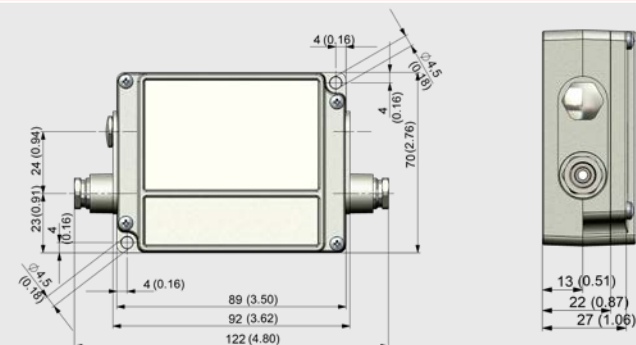

Electrical parameters

Power supply	5–24 V DC
LED display	2 green LEDs for power and fail-safe/ 3 red LEDs for alarm relay status
Isolation	500 VAC _{RMS} between PI/Xi camera and process
Outputs	3 analog / alarm outputs 3 alarm relays ¹⁾
Inputs	2 analog inputs 1 digital input
Bereiche	0/4–20 mA (für AO 1–3) 0–30 V / 400 mA (for alarm relays DO 1–3) 0–10 V (for AI 1–2) 24 V (for DI)


¹⁾ Active if AO1, 2 or 3 are programmed as alarm output

Programmable features

Analog inputs	<ul style="list-style-type: none"> • Emissivity setting • Ambient temperature compensation • Reference temperature • Uncommitted value • Flag control • Triggered snapshots, triggered recording, triggered line scan camera, triggered event grabber • Reset peak-/valley-hold
Digital input	<ul style="list-style-type: none"> • Flag control • Triggered snapshots, triggered recording, triggered line scan camera, triggered event grabber • Reset peak-/valley-hold
Analog outputs	<ul style="list-style-type: none"> • Main measure area • Measure area • Internal temperature • Flag status • Alarm • Frame sync. • Fail-safe • External communication • Center pixel (direct output)*

¹⁾ Available only for the models PI 1M / PI 05M

Example for a fail-safe monitoring of the PI with a connected PLC

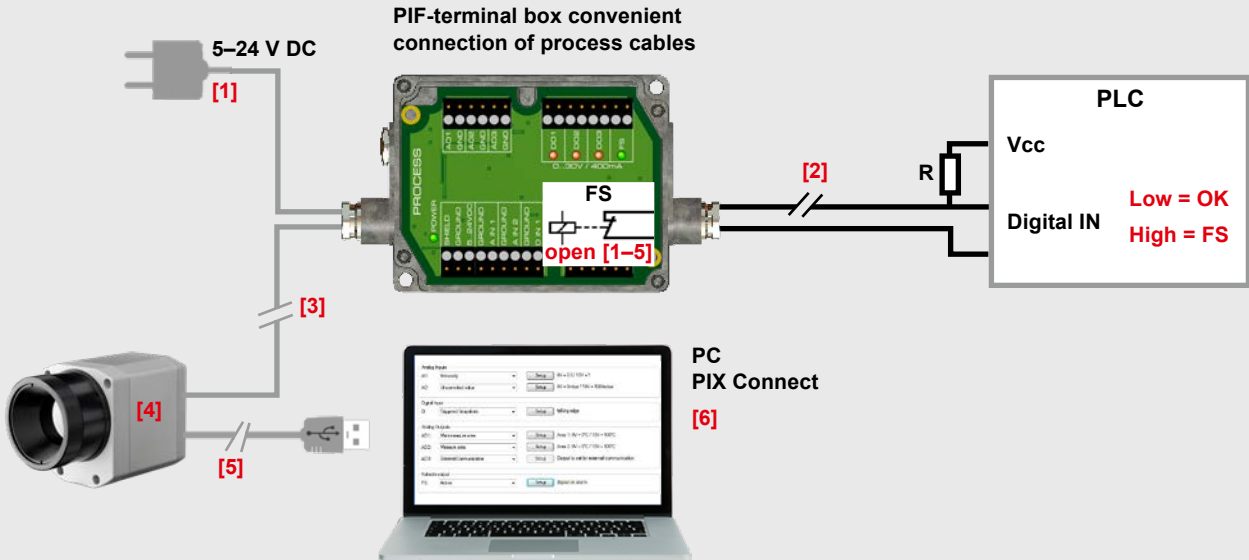

- Fail-safe monitoring states**
- [1] Breakdown of PIF power supply
 - [2] Cable break of fail-safe cable
 - [3] Interruption of cable PI – PIF
 - [4] Malfunction of PI camera
 - [5] Breakdown of PI power supply/ Interruption of USB cable
 - [6] Malfunction of PIX Connect software

Fail-Safe status:

Normal:	Relay closed	LED on
Alarm:	Relay open	LED off

Snapshot of programmable features

Configuration

PIF type: Industrial PIF (mA)

Analog Inputs (2)

AI1: Emissivity 0V = 0.5 / 10V = 1

AI2: Uncommitted value 0V = 0mbar / 10V = 100mbar

Digital Inputs (1)

DI: Triggered Snapshots falling edge

Analog Outputs (3)

AO1: Main measure area Area 1: 0mA = 0°C / 20mA = 100°C

AO2: Measure area Area 1: 0mA = 0°C / 20mA = 100°C

AO3: External Communication Output is set by external communication

Digital Outputs (0)

No defined digital outputs (DO).

Fail-safe

FS: Active Signal on alarm

Set number of ports like connected device Support proprietary PIF cable

Auto apply OK Apply Cancel

Config PIF channel

Process interface

Interface: AI1

Modus: Emissivity

Configuration range: 0 .. 1,1

Low Range Emissivity 0,500 = 0,00 V

High Range Emissivity 1,000 = 10,00 V

Parameter

Gain: 20,00 V/1

Offset: -10,00 V

Limits

0 = -10V 0V = 0,50

1,1 = 10,24V 10V = 1,00

Auto apply OK Apply Cancel

Specifications are subject to change without notice · PIF-BR-US2018-08-A

innovative infrared technology

Optris Infrared Sensing, LLC
200 International Drive, Suite 170
Portsmouth · NH 03801 USA
Phone: 603-766-6060
E-Mail: sales@optris-ir.com
www.optris.com

